

---

Subject: Re: Schematic Accuracy

Posted by [chicagobill](#) on Tue, 18 Feb 2014 17:24:47 GMT

[View Forum Message](#) <> [Reply to Message](#)

---

Glad to hear that it's back to working again. As we were discussing before, the thumping could be caused by transfer from wiring or through the power supply lines.

If you have an oscilloscope, try viewing the 8 volt dc supply lines around Q110 to Q112 to see if there is any ticking being induced into the power supply.

Earlier you stated that a lot of the resistors were changed in this amp. Were the 1% resistors like R156-R159 changed? If they were what were they replaced with?

Were caps C133 and C134 replaced in the 8 volt power supplies? And if they were what were they replaced with?

---